UNCLASSIFIED AD 409 940

DEFENSE DOCUMENTATION CENTER

FOR


SCIENTIFIC AND TECHNICAL INFORMATION

CAMERON STATION, ALEXANDRIA, VIRGINIA



UNCLASSIFIED

NOTICE: When government or other drawings, specifications or other data are used for any purpose other than in connection with a definitely related government procurement operation, the U. S. Government thereby incurs no responsibility, nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented invention that may in any way be related thereto.

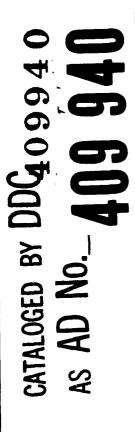


MONTHLY PROGRESS REPORT

FOR April 1963

 CONTRACT NO. DA-029-501-ORD-2631





Report No. 58-92-PR-56

DEVELOPMENT AND FABRICATION OF NON-DESTRUCTIVE SPECIFIC GRAVITY MEASURING EQUIPMENT EMPLOYING RADIATION TECHNIQUE

MONTHLY PROGRESS REPORT For April 1963

KAMAN NUCLEAR

A Division of The Kaman Aircraft Corporation

CONTRACT NO. DA-19-029-501-ORD-2631

ORD Project No. TA2-8051

Period:

1 April 1963 to 30 April 1963

"This report shall be destroyed by the recipient when no longer required for reference in accordance with AR389-5"

I. SUMMARY

Problems encountered in the manual and automatic "Stop" sequence involving carriage control, calculator control and block control circuits were investigated and corrected. Interaction between calculator control and block control circuits during normal operation was corrected. Operating difficulties in the calculator occurred and were corrected during the month. A detailed check-out of the carriage control system accuracy was in progress at the end of the reporting period.

II. PROGRESS DURING THE PERIOD

Several interactions between calculator, block control and carriage control circuits were noted during the "Start and Stop" sequences.

Initially, if the tape servo was resting in a limit position, system operation would not take place when the sample reached the "in-beam" or initial measurement position. This required rearrangement of the block start, calculator start and servo limit relays.

In normal operation, if the tape servo reached a limit during the calculator operate cycle, both calculator and block control circuits could operate simultaneously. This resulted in spurious signals to the block control steppers which threw the steppers out of synchronisum with the physical position of the attenuating blocks. The interlock circuits were therefore revised to lock out the block controls during the calculator cycle.

The calculator became inoperative during the succeeding tests due to failure of the print actuating solenoid. This circuit was then revised to reduce the holding voltage applied to the solenoid and to increase the wattage rating of

the dropping resistors.

The "Stop" sequence interlocks were then revised to prevent a move signal being sent to the carriage control in the "Manual" stop sequence, and to prevent tape servo and blower operation during the stop sequence. Additionally, a sneak circuit was discovered that was able to apply - 150 v.d.c. to the - 120 v.d.c. controlled bus, thus holding in the main power relay in certain circumstances. The block control and calculator control circuits were revised to eliminate this problem.

Tests were proceeding to determine the accuracy of the carriage control circuits at the and of the period. An interaction developed between the translation and rotation coincidence circuits in the "Full Scan" mode of operations. Corrective action was in process at the end of the reporting period.

III. PROGRESS PLANNED DURING THE NEXT PERIOD

The carriage control circuit revision should be completed, and scan movement accuracy checks started. Due to the addition of the length measuring system, accuracy of carriage movement in relation to the sample dimensions is highly important. Following completion of these checks, length measurements checks will be initiated.